 This quick start guide is not a replacement for the original operation manual. Anyone carrying out work with the machine or handling the machine in any other way must first read and understand the operation manual in full. You can find the original operation manual here:



Publisher:
ELEKTRO-THERMIT GMBH & CO. KG
A GOLDSCHMIDT COMPANY
Chemiestr. 24, 06132 Halle (Saale), Germany
Phone +49 345 7795-600, Fax +49 345 7795-770
et@goldschmidt.com, www.goldschmidt.com


Images: Goldschmidt Holding GmbH
Rev. 00/05.01.2023

GP 3600 B

PROFILE GRINDER

QUICK START GUIDE


1. Machine components

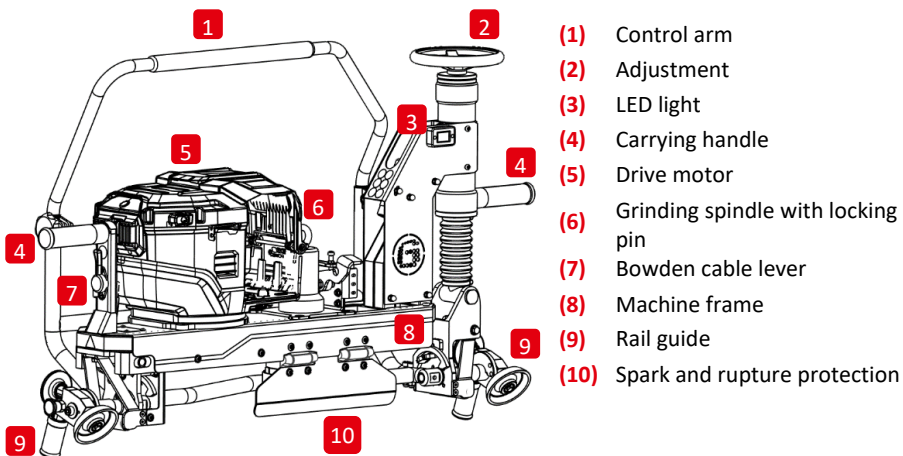

2. Before first use



The machine is supplied without batteries. Before the first start, it is therefore absolutely necessary to insert 2 batteries into the motor. To do this, open the protective cover and insert the batteries into the corresponding slots until they click into place.

Akku EGO Europe GmbH 12Ah (Typ:BA6720T)

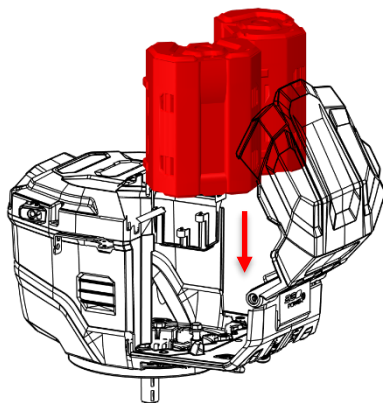

3. Starting the machine

- (1) Insert batteries.
- (2) Make sure that the spring pin for locking the grinding spindle is not latched in.
- (3) Set the motor to operational readiness: Press the button until the green light lights up.
- (4) Turn Bowden cable lever to the right, corresponds to "ON" position.

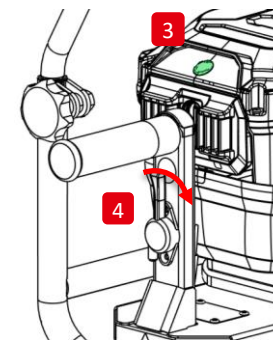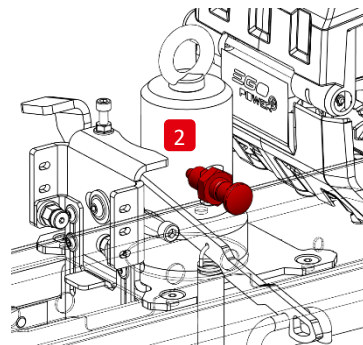

4. Changing the grinding stone

- (1) Push in the spring pin and rotate on the grinding stone until the spring pin latches into the grinding spindle.
- (2) Keep spring pin pressed in and use a suitable tool (e.g. ratchet with socket, size 30) to release the grinding stone from the grinding spindle.
- (3) Screw new grinding stone on as far as the stop.
- (4) Release the spring pin and make sure that the grinding spindle can rotate freely.

